

AIRLINE TRANSPORT PILOT 2022 TESTPREP

STUDY & PREPARE

Pass your test and know what is essential to become a safe, competent pilot and aircraft dispatcher—from the most trusted source in aviation training



AIRLINE TRANSPORT PILOT 2022 TEST PREP

STUDY & PREPARE

Pass your test and know what is essential to become a safe, pilot and aircraft dispatcher—from the most trusted source in aviation training

READER TIP

The FAA Knowledge Exam Questions can change throughout the year. Stay current with test changes; sign up for ASA's free email update service at **asa2fly.com/testupdate**



AVIATION SUPPLIES & ACADEMICS, INC. NEWCASTLE, WASHINGTON

Airline Transport Pilot Test Prep 2022 Edition

Aviation Supplies & Academics, Inc. 7005 132nd Place SE Newcastle, Washington 98059 asa@asa2fly.com | 425.235.1500 | asa2fly.com

© 2021 Aviation Supplies & Academics, Inc.

Visit **asa2fly.com/reader/TPATP** for the Reader Resources page containing additional information and updates related to this book.

Sample Federal Aviation Administration (FAA) questions herein contain information as of: September 2021. Stay informed of changes since the book was printed: asa2fly.com/testupdate

None of the material in this publication supersedes any documents, procedures or regulations issued by the Federal Aviation Administration.

Aviation Supplies & Academics, Inc. (ASA), assumes no responsibility for any errors or omissions. Neither is any liability assumed for damages resulting from the use of the information contained herein.

Important: This Test Prep should be sold with and used in conjunction with *Airman Knowledge Testing Supplement for Airline Transport Pilot and Aircraft Dispatcher* (FAA-CT-8080-7D). ASA reprints the FAA test figures and legends contained within this government document, and it is also sold separately and available from aviation retailers nationwide. Order #ASA-CT-8080-7D.

Cover photo: iStock.com/dell640

ASA-TP-ATP-22

ISBN 978-1-64425-153-9

Additional format available: eBook PDF ISBN 978-1-64425-154-6

Printed in the United States of America

2022 2021 5 4 3 2

About the Contributors

Jackie Spanitz

General Manager Aviation Supplies & Academics, Inc.

As ASA General Manager, Jackie Spanitz oversees maintenance and development of more than 1,000 titles and pilot supplies in the ASA product line. Ms. Spanitz has worked with airman training and testing for more than 25 years, including participation in the Airman Certification Standards (ACS) development committees. Jackie holds a Bachelor of Science in Aviation Technology from Western Michigan University, a Master of Science from Embry-Riddle Aeronautical University, and Instructor and Commercial Pilot certificates. She is the author of *Guide to the Flight Review*, and the technical editor for ASA's Test Prep and FAR/AIM series.

Andrea Georgio

Associate Professor Middle Tennessee State University (MTSU)

Andrea Georgiou is an associate professor and the flight dispatch coordinator in the MTSU Aerospace department. She earned a B.S. in Aerospace and Master of Aerospace Education from MTSU and a PhD in General Psychology from Capella University. Dr. Georgiou holds an FAA Aircraft Dispatch Certificate and a Private Pilot Certificate. She serves as an honors faculty member and teaches a wide range of undergraduate and graduate courses including flight dispatch, aviation laws and regulations, advanced aviation weather, professional pilot, introduction to aerospace, human factors, and aviation industries.

Aviation Supplies & Academics, Inc. (ASA) is an industry leader in the development and sale of aviation supplies and publications for pilots, flight instructors, aviation maintenance technicians, aircraft dispatchers, air traffic controllers, flight attendants, and drone operators. We manufacture and publish more than 1,000 products and have been providing trusted and reliable training materials to the aviation industry for over 80 years. Visit **asa2fly.com** for a free catalog.

Stay informed with ASA online resources.

1

Website





asa2fly.com/testupdate

Follow, like, share.
twitter.com/asa2fly
instagram.com/asa2fly
facebook.com/asa2fly
youtube.com/asa2fly
linkedin.com/company/asa2fly

asa2fly.com

Contents

Instructions

Chapter 1 Regulations

Applicable Regulations 1-3	
The ATP Certificate 1-3	
Flight Engineer Requirements 1-8	
Flight Attendants 1-9	;
Experience and Training Requirements 1-10	
Part 135 Flight Crew Requirements 1-17	
Flight Crew Duty Time Limits 1-25	-
Flight Duty Periods 1–26	
Dispatching and Flight Release 1-35	l
Fuel Requirements 1-44	
Carriage of Passengers and Cargo 1-47	
Part 135 Carriage of Passengers and	(
Cargo Requirements 1-52	
Emergency Equipment and Operations 1–55	
Part 135 Oxygen Requirements 1-67	-
National Transportation Safety Board (NTSB) 1-71	(
Part 135 Regulations 1-73	
Helicopter Regulations 1-89	

Chapter 2 Equipment, Navigation, and Facilities

Inoperative Equipment	2–3
Pitot-Static Instruments	
Electronic Flight Instruments	
Safety of Flight Equipment	
Communications	
Navigation Equipment	
Horizontal Situation Indicator (HSI)	2–23
Global Navigation	
Approach Systems	
GPS	
Automatic Dependent Surveillance –	
Broadcast (ADS-B)	
Airport Lighting and Marking	
Approach Lighting	

Chapter 3 Aerodynamics

Lift and Drag	3–3
Critical Engine and V _{MC}	
Maneuvering Flight	3–10
Stability	3–13
High Speed Flight	3–15
Primary Flight Controls	3–18
Tabs	3–23
High-Lift Devices	3–25
Helicopter Aerodynamics	3–27

Chapter 4 Performance

Engine Performance	4–3
Helicopter Systems	4–9
Takeoff Performance Terminology	4–10
Calculating V-Speeds	4–15
CRJ200 V-Speeds	4–15
Q400 V-Speeds	4–15
Transport Aircraft 2 V-Speeds	4–15
Transport Aircraft 1 V-Speeds	4–16

(continued)

Calculating Takeoff Power	4-20
CRJ200 Takeoff Thrust Settings	4-20
Q400 Takeoff Power	4-20
Transport Aircraft 2 Takeoff EPR	4-20
Climb Performance	4-22
CRJ200 Performance Tables	4-22
Q400 Performance Tables	4-23
Q400 Climb and Cruise Power Tables	4-23
Transport Aircraft 2 Climb Performance	
Tables	4-23
Transport Aircraft 2 Climb and Cruise	
Power Tables	
Cruise Performance	
Landing Considerations	
Landing Performance Tables and Graphs	
Miscellaneous Performance	
Engine-Out Procedures	4–41
C208 Aircraft Performance	4-46
Cessna 208 Performance Tables	4-53
Commuter Aircraft Performance	4-56
Helicopter Performance	4-70
Flight Planning Graphs and Tables	4-78
Typical Flight Logs	4-83
Computation of Temperature	
at Cruise Altitude	4–83
Computation of True Airspeed	
Using Mach Number	
Specific Range	4–84

Chapter 5 Weight and Balance

Center of Gravity Computation	5–3
Stabilizer Trim Setting	5–7
Changing Loading Conditions	5–8
C208 Weight and Balance	. 5–12
Commuter Aircraft Weight and Balance	. 5–13
Helicopter Weight and Balance	. 5–24
Helicopter Weight and Balance: CG Shifts	. 5–25
Helicopter Weight and Balance: Load Limits	. 5–27
Helicopter Weight and Balance: Lateral CG	. 5–29
Floor Loading Limits	. 5–30

Chapter 6 Flight Operations

Airspace	6–3
NOTAMs (NOtices To AirMen)	6–13
Flight Plans	6–14
Alternate Airport Planning	6–17
ATC Clearances	6–21
Takeoff Procedures	6–26
Instrument Approaches	6–28
Landing	6–36
Communications	6–39
Speed Adjustments	6–42
Holding	6–44
Charts	6–50

Chapter 7 Emergencies, Hazards, and Flight Physiology

Flight Emergencies and Hazards	
Flight Physiology	7–11

Chapter 8 Meteorology and Weather Services

The Atmosphere	8–3
Weather Systems	8–8
Stability and Instability of Air	8–11
Fog and Rain	8–15
Thunderstorms	8–18
Wind Shear	8–22
Frost and Ice	8–29
Icing	8–29
Hazards of Structural lcing	8–30
Frost Formation	8–31
Turbulence	8–38
Arctic and Tropical Weather Hazards	8–42
Aviation Routine Weather Report (METAR)	8–43
The Terminal Aerodrome Forecast (TAF)	8–47
Enroute Forecasts	8–48
Surface Analysis and Constant Pressure	
Charts	8–51
Reports and Forecasts of Hazardous Weather	
PIREPs	8–56

Cross References

A: Question Number and Page NumberA-	1
--------------------------------------	---

Updates and Practice Tests

Free Test Updates for the One-Year Life Cycle of Test Prep Books

The FAA modifies tests as needed throughout the year. ASA keeps abreast of changes to the tests and posts free Test Updates on the ASA website. Before taking your test, be certain you have the most current information by visiting the ASA Test Updates webpage: **asa2fly.com/testupdate**. Additionally, sign up for free email notifications, which are sent when new Test Updates are available.

We Invite Your Feedback

After you take your FAA exam, let us know how you did. Were you prepared? Did ASA's products meet your needs and exceed your expectations? We want to continue to improve these products to ensure applicants are prepared and become safe aviators. Send your feedback to: **cfi@asa2fly.com**.



Introduction

Welcome to the Aviation Supplies & Academics, Inc., (ASA) Test Prep Series. This series has been helping pilots prepare for the FAA Knowledge Tests for more than 60 years with great success. We are confident that with proper use of this book you will score very well on any of the Airline Transport Pilot tests.

Begin your studies with a classroom or home-study ground school course, which will involve reading a comprehensive textbook. Visit the dedicated Reader Resource webpage for this Test Prep (**asa2fly. com/reader/TPATP**) and become familiar with the FAA guidance materials available for this certification exam. Then use this Test Prep to prepare for your exam: read the question, select your choice for the correct answer, and then read the explanation. Use the references that conclude each explanation to identify additional resources for further study of a subject. Upon completion of your studies, take practice tests at **prepware.com** (*see* inside the front cover for your five free practice tests).

The questions in this book have been arranged into chapters based on subject matter to promote better understanding, aid recall, and provide a more efficient study guide. Place emphasis on questions most likely to be included in your test (identified by the aircraft category above each question). For example, a pilot preparing for the ATP Multi-engine test would focus on the questions marked "ALL" and "ATM"; a pilot preparing for the ATP Single-engine test would focus on the questions marked "ALL" and "ATS"; a pilot preparing for the ATP Helicopter (135) test would focus on the questions marked "ALL" and "RTC"; and candidates for the Dispatcher certificate would focus on the questions marked "ALL" and "ADX."

Prior to taking an FAA Airman Knowledge Test, all applicants must establish an FAA Tracking Number (FTN) by creating a profile in the Integrated Airman Certification and Rating Application (IACRA) system at **iacra.faa.gov**. Then visit **faa.psiexams.com** to register for your exam and take FAA-created practice tests to become familiar with the computer testing platform.

It is important to answer every question assigned on your FAA Knowledge Test. If in their ongoing review, the FAA decides a question has no correct answer, is no longer applicable, or is otherwise defective, your answer will be marked correct no matter which one you chose. However, you will not be given the automatic credit if you have not marked an answer. Unlike some other exams you may have taken, there is no penalty for guessing in this instance.

The FAA exams are "closed tests" which means the exact database of questions is not available to the public. The question and answer choices in this book are based on our extensive history and experience with the FAA testing and airman certification process. You might see similarly worded questions on your official FAA exam, or answer stems might be rearranged from the order you see in this book. Therefore, be sure to fully understand the intent of each question and corresponding answer while studying, rather than memorizing the letter associated with the correct response. You may be asked a question that has unfamiliar wording; studying and understanding the information in this book and the associated references will give you the tools to answer question variations with confidence.

If your study leads you to question an answer choice, we recommend you seek the assistance of a local instructor. We welcome your questions, recommendations, and concerns—send them to:

Aviation Supplies & Academics, Inc.

7005 132nd Place SE Newcastle, WA 98059-3153 Voice: 425.235.1500 Fax: 425.235.0128 Email: cfi@asa2fly.com Website: asa2fly.com The FAA appreciates testing experience feedback. You can contact them at:

Federal Aviation Administration

AFS-630, Airman Testing Standards Branch PO Box 25082 Oklahoma City, OK 73125 Email: afs630comments@faa.gov

ASA Test Prep Layout

Sample FAA questions have been sorted into chapters according to subject matter. Within each chapter, similar questions are grouped together following introductory chapter text. Figures referenced in the chapter text are numbered with the appropriate chapter number, e.g., "Figure 1-1" is Chapter 1's first chapter text figure.

Some sample FAA questions refer to Figures or Legends immediately following the question number, e.g., "8201. (Refer to Figure 14.)." These are FAA Figures and Legends which can be found in the separate booklet *Airman Knowledge Testing Supplement for Airline Transport Pilot and Aircraft Dispatcher* (CT-8080-7D). This supplement is bundled with this Test Prep and is the exact same material you will have access to when you take your computerized test. We provide it separately so you can become accustomed to referring to the FAA Figures and Legends as you would during the test.

Following each sample FAA test question is ASA's explanation in italics. The last line of the explanation contains a Learning Statement Code (LSC), for those tests referencing an FAA Practical Test Standard (PTS), or Airman Certification Standards (ACS) code, for those tests with an ACS, as well as a reference for further study. Some questions include an explanation for the incorrect answers for added clarity. When you encounter a difficult question, find the LSC or ACS code in Cross-Reference B, and then look for material relating to the subject description within the given reference(s). Refer to Cross-Reference B for more information on how to use LSCs or ACS codes for effective studying.

Answers to each question are found at the bottom of each page.

EXAMPLE:	Chapter text
Four aerodynamic forces are considered to be basic been maneuvers. There is the downward-acting force called upward-acting force called LIFT, and there is the rearw overcome by the forward-acting force called THRUST.	d WEIGHT which must be overcome by the ard-acting force called DRAG, which must be Category rating. This question may be
ALL, ATM, ATS, ADX, RTC <	found on tests for these ratings.*
8201. (<u>Refer to Figure 14.</u>) The four forces acting on an airplane in flight are	See separate book <i>Airman Knowledge</i> Testing Supplement (CT-8080-XX)
 A— lift, weight, thrust, and drag. B— lift, weight, gravity, and thrust. C— lift, gravity, power, and friction. 	Question and answer choices
Lift, weight, thrust, and drag are the four basic aerodynamic forces acting on an aircraft in flight. (PLT235, AA.III.A.K1) — FAA-H-8083-25 <	Explanation
Answer (B) is incorrect because the force of gravity is always the same number and reacts with the airplane's mass to produce a different weight for almost every airplane. Answer (C) is incorrect because weight is the final product of gravity, thrust is the final product of power,	
and drag is the final product of gravity, thrust is the final product of power, and drag is the final product of friction. Power, gravity, and friction are only parts of the aerodynamic forces of flight.	Code line. FAA LSC and ACS codes in parentheses, followed by references for further study.
Incorrect answer explanation. Reasons why answer choices are <i>incorrect</i> explained here.	
 Note: The FAA does <i>not</i> identify which questions are on the different ratings' rating category, it may be found on <i>any</i> of the tests. 	tests. Unless the wording of a question is pertinent to only one

ALL = All operations ATM = Multi-engine operations ATS = Single-engine operations ADX = Dispatcher RTC = Rotorcraft

Chapter 2 Equipment, Navigation, and Facilities

Inoperative Equipment 2-3 **Pitot-Static Instruments** 2-4 Electronic Flight Instruments 2-10 Safety of Flight Equipment 2-13 Communications 2-17 Navigation Equipment 2-18 Horizontal Situation Indicator (HSI) 2-23 **Global Navigation** 2-29 Approach Systems 2-30 GPS 2-37 Automatic Dependent Surveillance – Broadcast (ADS-B) 2-43 Airport Lighting and Marking 2-44 Approach Lighting 2-54

Inoperative Equipment

A certificate holder's manual must contain enroute flight, navigation and communication procedures, including procedures for the dispatch, release or continuance of a flight if a required piece of equipment becomes inoperative.

When any required instrument or equipment in an aircraft is inoperative, the airplane cannot be flown unless that aircraft's **Minimum Equipment List (MEL)** allows such a flight.

The pilot-in-command of an aircraft operating IFR in controlled airspace shall report to ATC immediately any malfunction of navigational, approach or communications equipment that occurs in flight. The report must include:

- Aircraft identification;
- Equipment affected;
- Degree to which the capability of the aircraft to operate IFR in the ATC system is impaired; and
- Nature and extent of assistance desired from ATC.

ALL

9407. An approved minimum equipment list or FAA Letter of Authorization allows certain instruments or equipment

- A—to be inoperative prior to beginning a flight in an aircraft if prescribed procedures are followed.
- B—to be inoperative anytime with no other documentation required or procedures to be followed.
- C—to be inoperative for a one-time ferry flight of a large airplane to a maintenance base without further documentation from the operator or FAA with passengers on board.

The Minimum Equipment List and the letter of authorization constitute a supplemental type certificate for the aircraft. The approved Minimum Equipment List must provide for the operation of the aircraft with the instruments and equipment in an inoperable condition (PLT405, AA.II.A.K2c) — 14 CFR §91.213

ATM, ATS, RTC

9380. What action is necessary when a partial loss of ILS receiver capability occurs while operating in controlled airspace under IFR?

- A—Continue as cleared and file a written report to the Administrator if requested.
- B—If the aircraft is equipped with other radios suitable for executing an instrument approach, no further action is necessary.
- C-Report the malfunction immediately to ATC.

The pilot-in-command of an aircraft operating IFR in controlled airspace shall report to ATC as soon as practical any malfunction of navigational, approach or communication equipment that occurs in flight. (PLT356, AA.VI.E.K1) — 14 CFR §91.187

Answer (A) is incorrect because any malfunction of approach equipment must be reported in flight, not by a written report. Answer (B) is incorrect because, although another type of instrument approach may be executed if permission is granted by ATC, any malfunction of approach equipment should be reported.

ATM, ATS, RTC

9381. What action should be taken if one of the two VHF radios fail while IFR in controlled airspace?

- A-Notify ATC immediately.
- B-Squawk 7600.
- C-Monitor the VOR receiver.

The pilot-in-command of an aircraft operating IFR in controlled airspace shall report to ATC as soon as practical any malfunction of navigational, approach or communication equipment that occurs in flight. (PLT162, AA.VI.D.K3) — 14 CFR §91.187

Answer (B) is incorrect because, although you have experienced a communications failure, it is only a partial one. You still have one operational VHF radio and all other radios are working normally, so a squawk of 7600 is not needed. Answer (C) is incorrect because you still have an operable VHF radio for communication, so monitoring of a NAVAID is not needed. The only pilot action required is notification to ATC of the problem.

ATM, ATS, RTC

9386. While flying IFR in controlled airspace, if one of the two VOR receivers fails, which course of action should the pilot-in-command follow?

- A—No call is required if one of the two VOR receivers is operating properly.
- B-Advise ATC immediately.
- C—Notify the dispatcher via company frequency.

The pilot-in-command of an aircraft operating IFR in controlled airspace shall report to ATC as soon as practical any malfunction of navigational, approach or communication equipment that occurs in flight. (PLT406, AA.VI.D.K3) — 14 CFR §91.187

Answer (A) is incorrect because any malfunction of a navigational radio should be reported, no matter how slightly it may affect the conduct of the flight. Answer (C) is incorrect because, although this may be a common practice among the air carriers, the regulations require notification to ATC of the malfunction.

ATM, ATS, RTC

9387. While flying in controlled airspace under IFR, the ADF fails. What action is required?

A—Descend below Class A airspace.

B—Advise dispatch via company frequency.

C—Notify ATC immediately.

The pilot-in-command of an aircraft operating IFR in controlled airspace shall report to ATC as soon as practical any malfunction of navigational, approach or communication equipment that occurs in flight. (PLT406, AA.VI.D.K3) — 14 CFR §91.187

Answer (A) is incorrect because controlled airspace exists far below positive control airspace (base of 18,000 feet MSL), and any loss of a navigational aid should be reported to ATC. Answer (B) is incorrect because, although this may be a common practice among the air carriers, the regulations require notification to ATC of the malfunction.

ATM, ADX

8278. If a required instrument on a multi-engine airplane becomes inoperative, which document required under 14 CFR Part 121 dictates whether the flight may continue en route?

- A—A Master Minimum Equipment List for the airplane.
- B—Original dispatch release.
- C-Certificate holder's manual.

Each certificate holder's manual must contain enroute flight, navigation, and communication procedures for the dispatch, release or continuance of flight if any item of equipment required for the particular type of operation becomes inoperative or unserviceable en route. (PLT436, AA.I.G.K4) — 14 CFR §121.135

Pitot-Static Instruments

Modern jet transports usually have three pitot-static systems. There are separate systems for the captain's and co-pilot's instruments plus an auxiliary system that provides a backup for either of the two primary systems. The instruments that require static pressure input are **airspeed**, **Mach**, **altitude** and **vertical speed indicators**. In addition, the airspeed and Mach indicators need a source of pitot pressure. Besides the flight instruments, static pressure input is required for the Mach warning, autopilot, flight director, flight recorder and cabin differential pressure. Pitot input is required for all those systems except for cabin differential pressure. The usual source for these non-flight instruments is the auxiliary pitot-static system. *See* Figure 2-1.

Altimeters compare the sea level pressure setting in their window with the outside air pressure sensed through the static system. The difference is displayed as the altitude above sea level. Part of the preflight check is to verify the accuracy of the altimeters. An altimeter should be considered questionable if the indicated altitude varies by more the 75 feet from a known field elevation.

The altimeter setting used by pilots is always the station pressure of the reporting station corrected to sea level. **Station pressure** is the actual pressure at field elevation.

True altitude is the actual height of the aircraft above sea level. This is the same as indicated altitude when standard temperatures exist. When the temperature is warmer than standard, true altitude is higher than indicated altitude. When the temperature is colder than standard day conditions, just the opposite is true. Corrected altitude (approximately true altitude) can be calculated but it is neither practical

Answers						
9386	[B]	9387	[C]	8278	[C]	

nor useful to do so in most situations. When setting an altimeter, a pilot should just use the appropriate altimeter setting and disregard the effects of nonstandard atmospheric pressures and temperatures.

Pressure altitude is the altitude indicated when the altimeter is set to standard sea level pressure of 29.92" Hg. Density altitude is used in aircraft performance computations. It is pressure altitude corrected for nonstandard temperatures. If the temperature is warmer than standard, density altitude will be higher than pressure altitude.

The local altimeter setting is used when flying below FL180 and the altimeter is 31.00" Hg or less. Special procedures apply when the local pressure is more than 31.00" Hg because most altimeters cannot be set higher than that. In the United States, all altimeters are set to 29.92" Hg when climbing through FL180. Caution: outside the United States the transition altitude is often something other than FL180.

A common reason for altimeter errors is incorrect setting of the altimeter. If the setting in the altimeter is higher than the actual sea level pressure, the altimeter will read higher than the actual altitude. If the setting is too low, the altimeter will read lower than it really is. As a rough rule of thumb, the magnitude of the error is about 1,000 feet for each 1" Hg that the altimeter is off. For example, if the altimeter is set to 29.92" Hg, but the real sea level pressure is 30.57" Hg, the altimeter will read about 650 feet lower than the actual airplane's altitude (30.57 - 29.92 = .65" Hg = 650 feet). In this example, the airplane would be 650 feet higher than the indicated altitude.

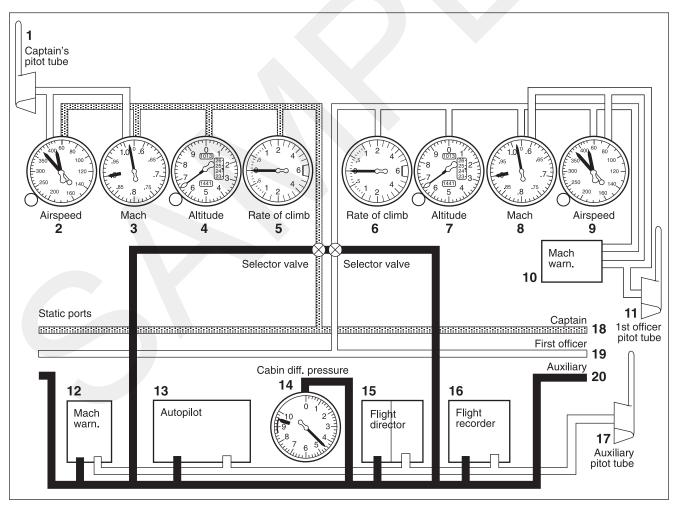


Figure 2-1. Typical pitot-static system

The airspeed indicators compare pitot pressure with static pressure and display the difference as **indicated airspeed**. This indicated airspeed equals the aircraft's actual speed through the air (True Airspeed) only under standard day conditions at sea level. Under almost all flight conditions, true airspeed will be higher than indicated airspeed because of the lower ambient pressures at altitude.

The Machmeter displays aircraft speed as a percentage of the speed of sound. For example, an aircraft cruising at a Mach number of .82 is flying at 82% of the speed of sound. The Machmeter works in a manner similar to the airspeed indicator in that it compares pitot and static pressure, but these inputs are corrected by an altimeter mechanism.

If a pitot tube becomes blocked, the airspeed and Mach indicators will read inaccurately. If pressure is trapped in the pitot line, the airspeed will read inaccurately high as the aircraft climbs, low as it descends, and will be unresponsive to changes in airspeed. The airspeed indicator acts as an altimeter because only the static pressure changes. This situation occurs in icing conditions if both the ram air inlet and the drain hole of the pitot tube become completely blocked by ice.

If the pitot tube is blocked but the static port and the pitot drain hole remain open, the indicated airspeed will drop to zero. The drain pitot tube drain hole allows the pressure in the pitot line to drop to atmospheric and therefore there is no differential between the static and pitot pressures.

Pitot tubes and static ports are electrically heated to prevent ice formations that could interfere with proper operation of the systems. They are required to have "power on" indicator lights to show proper operation. In addition, many aircraft have an ammeter that shows the actual current flow to the pitot and static ports.

Since the magnetic compass is the only direction-seeking instrument in most airplanes, the pilot must be able to turn the airplane to a magnetic compass heading and maintain this heading. It is influenced by magnetic dip which causes northerly turning error and acceleration/deceleration error. When northerly turning error occurs, the compass will lag behind the actual aircraft heading while turning through headings in the northern half of the compass rose, and lead the aircraft's actual heading in the southern half. The error is most pronounced when turning through north or south, and is approximately equal in degrees to the latitude.

The acceleration/deceleration error is most pronounced on headings of east and west. When accelerating, the compass indicates a turn toward the north, and when decelerating it indicates a turn toward the south. The acronym **ANDS** is a good memory aid:

- A accelerate
- N north
- **D** decelerate
- S south

No errors are apparent while on east or west headings, when turning either north or south.

ALL

9174. Which pressure is defined as station pressure?

- A—Altimeter setting.
- B—Actual pressure at field elevation.
- C—Station barometric pressure reduced to sea level.

The pressure measured at a station or airport is "station pressure" or the actual pressure at field elevation. (PLT166, AA.I.A.K13) — AC 00-6

Answer (A) is incorrect because altimeter setting is the value to which the scale of a pressure altimeter is adjusted to read field elevation. Answer (C) is incorrect because station barometric pressure reduced to sea level is a method to readily compare station pressures between stations at different altitudes.

ALL

9164. What is corrected altitude (approximate true altitude)?

- A—Pressure altitude corrected for instrument error.
- B—Indicated altitude corrected for temperature variation from standard.
- C—Density altitude corrected for temperature variation from standard.

True altitude is indicated altitude corrected for the fact that nonstandard temperatures will result in nonstandard pressure lapse rates. (PLT023, AA.I.A.K13) — AC 00-6

Answer (A) is incorrect because pressure altitude corrected for instrument error is a nonexistent concept. Answer (C) is incorrect because density altitude is pressure altitude corrected for temperature variation from standard. Density altitude is a final figure and not subject to additional adjustments.

ATM, ATS, RTC

9099. When setting the altimeter, pilots should disregard

- A—effects of nonstandard atmospheric temperatures and pressures.
- B—corrections for static pressure systems.
- C—corrections for instrument error.

Pilots should disregard the effect of nonstandard atmospheric temperatures and pressures except that low temperatures and pressures need to be considered for terrain clearance purposes. (PLT166, AA.I.A.K13) — AIM ¶7-2-2

Answers (B) and (C) are incorrect because altimeters are subject to instrument errors and to errors in the static pressure system. A pilot should set the current reported altimeter setting on the altimeter setting scale. The altimeter should read within 75 feet of field elevation. If not, it is questionable and should be evaluated by a repair station.

ALL

9173. If the ambient temperature is colder than standard at FL310, what is the relationship between true altitude and pressure altitude?

- A—They are both the same, 31,000 feet.
- B—True altitude is lower than 31,000 feet.
- C—Pressure altitude is lower than true altitude.

True altitude is indicated altitude corrected for the fact that nonstandard temperatures will result in nonstandard pressure lapse rates. In warm air, you fly at a true altitude higher than indicated. In cold air, you fly at a true altitude lower than indicated. Pressure altitude is the altitude indicated when the altimeter is set to the standard sea level pressure (29.92" Hg). In the United States, altimeters are always set to 29.92" Hg at and above 18,000 feet. This question assumes the difference between the pressure altitude and the indicated altitude (local altimeter setting) is not significant enough to reverse the effects of the temperature. (PLT023, AA.I.D.K3) — AC 00-6

Answer (A) is incorrect because both true and pressure altitude would be the same at FL310 if the ambient air temperature was standard. Answer (C) is incorrect because pressure altitude would be lower than true altitude in warmer than standard air temperature.

ALL

9173-1. When the temperature is -20°C at 15,000 feet indicated, you know that

- A—altimeters automatically compensate for temperature variations.
- B—the altimeter is indicating higher than true altitude.
- C-the altimeter is indicating lower than true altitude.

The ISA for 15,000 feet is -15°C. When the temperature is colder than standard, the altimeter will indicate higher than true altitude. (PLT023, AA.I.D.K3) — AC 00-6

9099 [A]

9173 [B]

9173-1 [B]

ALL

9172. If the ambient temperature is warmer than standard at FL350, what is the density altitude compared to pressure altitude?

- A—Lower than pressure altitude.
- B—Higher than pressure altitude.
- C—Impossible to determine without information on possible inversion layers at lower altitudes.

Pressure altitude is the altitude indicated when the altimeter is set to the standard sea level pressure (29.92" Hg). Density altitude is pressure altitude corrected for nonstandard temperature. A warmer than standard temperature will result in a density altitude higher than the pressure altitude. (PLT023, AA.I.D.K3) — AC 00-6

Answer (A) is incorrect because density altitude is higher when air temperature is warmer than standard. Answer (C) is incorrect because density altitude is pressure altitude corrected for nonstandard temperatures. Pressure altitude is based on a standard pressure atmosphere at a particular altitude, and inversion layers at lower levels have no effect on pressure altitude.

ALL

Pressure altitude	1,000 ft
True air temperature	10°C

From the conditions given, the approximate density altitude is

A-1,000 feet MSL

B-650 feet MSL

C-450 feet MSL

Answers

- 1. Using an E6B flight computer, refer to the right-hand "Density Altitude" window. Note that the scale above the window is labeled air temperature (°C). The scale inside the window itself is labeled pressure altitude (in thousands of feet). Rotate the disc and place the pressure altitude of 1,000 feet opposite an air temperature of 10°C.
- 2. The density altitude shown in the window is 650 feet.

You can also answer this using an electronic flight computer, such as the CX-3. Select Altitude from the CX-3 FLT menu. (PLT005, AA.I.D.K3) — AC 00-6

ALL

9163. En route at FL270, the altimeter is set correctly. On descent, a pilot fails to set the local altimeter setting of 30.57. If the field elevation is 650 feet, and the altimeter is functioning properly, what will it indicate upon landing?

A—585 feet. B—1,300 feet. C—Sea level.

One inch of Hg pressure is equal to about 1,000 feet of altitude. In the United States, altimeters are always set to 29.92" Hg at and above 18,000 feet. If the altimeter is not reset when descending into an area with a local altimeter setting of 30.57" Hg, an error of 650 feet will result (30.57 - 29.92 = .65 = 650 feet). If the altimeter is set lower than the actual setting, it will read lower than the actual altitude. (PLT166, AA.I.D.K3) — AC 00-6

Answer (A) is incorrect because 585 feet is the result of subtracting 65 feet rather than subtracting 650 feet. Answer (B) is incorrect because 1,300 feet is the result of adding 650 feet rather than subtracting 650 feet.

ATM, ATS, RTC

9080. During an en route descent in a fixed-thrust and fixed-pitch attitude configuration, both the ram air input and drain hole of the pitot system become completely blocked by ice. What airspeed indication can be expected?

- A—Increase in indicated airspeed.
- B—Decrease in indicated airspeed.
- C—Indicated airspeed remains at the value prior to icing.

If both the ram air input and the drain hole are blocked, the pressure trapped in the pitot line cannot change and the airspeed indicator may react as an altimeter. The airspeed will not change in level flight even when actual airspeed is varied by large power changes. During a climb the airspeed indication will increase. During a descent the airspeed indication will decrease. (PLT128, AA.I.D.K3) — AC 91-43

Answer (A) is incorrect because indicated airspeed will decrease in a descent. Answer (C) is incorrect because indicated airspeed will remain at the same value during level flight.

ATM, ATS, RTC

9081. What can a pilot expect if the pitot system ram air input and drain hole are blocked by ice?

- A—The airspeed indicator may act as an altimeter.
- B—The airspeed indicator will show a decrease with an increase in altitude.
- C—No airspeed indicator change will occur during climbs or descents.

If both the ram air input and the drain hole are blocked, the pressure trapped in the pitot line cannot change and the airspeed indicator may react as an altimeter. The airspeed will not change in level flight even when actual airspeed is varied by large power changes. During a climb the airspeed indication will increase. During a descent the airspeed indication will decrease. (PLT337, AA.VII.A.K6) — AC 91-43

Answer (B) is incorrect because the airspeed indicator will show an increase (not decrease) with an increase in altitude. Answer (C) is incorrect because differential pressure between the pitot tube and static air source changes, and so does indicated airspeed.

ATM, ATS, RTC

9082. If both the ram air input and drain hole of the pitot system are blocked by ice, what airspeed indication can be expected?

- A—No variation of indicated airspeed in level flight if large power changes are made.
- B—Decrease of indicated airspeed during a climb.
- C—Constant indicated airspeed during a descent.

If both the ram air input and the drain hole are blocked, the pressure trapped in the pitot line cannot change and the airspeed indicator may react as an altimeter. The airspeed will not change in level flight even when actual airspeed is varied by large power changes. During a climb the airspeed indication will increase. During a descent the airspeed indication will decrease. (PLT337, AA.VII.A.K6) — AC 91-43

Answer (B) is incorrect because, during a climb, it will indicate an increase due to the stronger differential pressure in the blocked pitot tube relative to the static vents. Answer (C) is incorrect because indicated airspeed would change with changes in altitude.

ATM, ATS, RTC

9222. How will the airspeed indicator react if the ram air input to the pitot head is blocked by ice, but the drain hole and static port are not?

- A-Indication will drop to zero.
- B—Indication will rise to the top of the scale.
- C—Indication will remain constant but will increase in a climb.

If the pitot tube becomes blocked but pressure is not trapped in the pitot lines, the indicated airspeed will drop to zero since the pitot pressure will be approximately equal to the static pressure. (PLT337, AA.VII.A.K6) — AC 00-6

Answer (B) is incorrect because the airspeed indication will drop if only the ram air input is blocked. Answer (C) is incorrect because the pressure in the airspeed line will vent out through the hole and the indication will drop to zero.

ATM, ATS, RTC

9934. During a constant-rate climb in IMC above the freezing level, you notice that both the airspeed and altitude are increasing. This indicates the

- A—aircraft is in an unusual attitude.
- B—gyroscopic instruments have failed.
- C-pitot-static system has malfunctioned.

If the pitot tube ram pressure hole and drain hole become obstructed, the airspeed indicator operates like an altimeter as the aircraft climbs and descends. In this situation as the aircraft climbs and the altimeter increases, so will the airspeed indicator. (PLT337, AA.VII.A.K6) — FAA-H-8083-15

Answer (A) is incorrect because an aircraft in an unusual attitude with an increasing airspeed will result in a decreasing altitude. Answer (B) is incorrect because the airspeed indicator and altimeter operate off the pitot-static system.

9222 [A]

9934 [C]

Electronic Flight Instruments


Electronic flight instrument systems integrate many individual instruments into a single presentation called a primary flight display (PFD). Flight instrument presentations on a PFD differ from conventional instrumentation not only in format, but sometimes in location as well. For example, the attitude indicator on the PFD is often larger than conventional round-dial presentations of an artificial horizon. Airspeed and altitude indications are presented on vertical tape displays that appear on the left and right sides of the primary flight display. The vertical speed indicator is depicted using conventional analog presentation. Turn coordination is shown using a segmented triangle near the top of the attitude indicator. The rate-of-turn indicator appears as a curved line display at the top of the heading/navigation instrument in the lower half of the PFD.

ATM, ATS, RTC

8206. (*See* Figure shown below.) You see the indication in the figure on your PFD, but your standby indicator reads 120 knots and the power is set for 120-knot cruise in level flight. You decide the

- A—pitot tube may be plugged with ice or a bug.
- B—standby indicator is defective because there is no red 'X' on the speed tape display.
- C-airspeed means attitude is incorrect.

The airspeed indicator on the PFD is indicating a TAS of 64 knots. If this instrument had failed, the numbers would be replaced with a large red X. The stand-by airspeed indicator reading 120 knots suggests this instrument is working fine. The line coming out of the pitot tube splits to feed multiple instruments. The most likely culprit is a bug or ice blockage occurring past the split, in the line that feeds the Air Data Computer (ADC) for the PFD. This would allow the stand-by gauge to work properly, but cause the ASI on the PFD to give a false indication. True Airspeed is calculated in the ADC by correcting CAS with OAT probe data, so this explains why

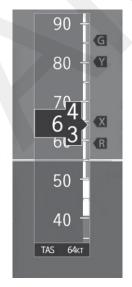

Question 8206



Figure 2-2. A typical primary flight display (PFD)

the TAS is correspondingly low. The pitot lines need to be cleared; applying pitot heat may or may not help at this point. (PLT524, AA.I.A.K9) — FAA-H-8083-6

Answer (B) is incorrect because you cannot assume the standby is failed if you have cruise power and level attitude; the red Xs appear on the speed tape when the ADC fails or when one of the pressure transducers fail. Answer (C) is incorrect because an attitude instrument savvy pilot would discern attitude correctness by cross referencing other instruments and hearing the pitch of the engine would decide that power and a level attitude must be an indicator problem and have nothing to do with attitude correctness.

ALL

9769-3. What manual should the crewmembers of an air carrier reference when determining if a portable electronic device is allowed to be operated on an aircraft?

A—The aircraft's approved flight manual.

- B—The air carrier's policy and procedures manual.
- C—The operating manual for the device.

For operating certificate holders, the decision to allow PED usage must be made by the operator. Pilots can reference the air carrier's policy and procedures manual to determine if PEDs are allowed. (PLT524, AA.I.E.K11) — AC 91.21-1

Answers

8206 [A] 9769-3 [B]

ALL

- 9769. Automated flight decks or cockpits
- A—enhance basic pilot flight skills.
- B-decrease the workload in terminal areas.
- C—often create much larger pilot errors than traditional cockpits.

Advanced avionics were designed to increase safety as well as the utility of the aircraft, particularly during increased workload phases, such as in the terminal areas. (PLT524, AA.I.E.K2) — FAA-H-8083-6

Answer (A) is incorrect because automation has been shown to erode some flying skills when they are not kept proficient. Answer (C) is incorrect because while automation can make some errors more evident and hide others, it does not result in larger pilot errors than traditional cockpits.

ALL

9769-1. Automated flight decks or cockpits

- A-improve basic flight skills.
- B—decrease the workload in terminal areas.
- C—sometimes hide errors.

Automation can make some errors more evident and hide others. (PLT524, AA.I.E.K2) — FAA-H-8083-6

ALL

9769-2. When flying an aircraft with electronic flight displays (EFDs), risk increases

- A—if the pilot expects the electronics to enhance flight safety and remove pilot error.
- B—when the pilot expects the equipment to malfunction on occasion.
- C—if the pilot believes the EFD will compensate for lack of skill and knowledge.

Automation has been shown to erode some flying skills when they are not kept proficient. (PLT524, AA.I.E.K2) — FAA-H-8083-6

ALL

9830. Automation has been found to

- A-create higher workloads in terminal areas.
- B-improve crew situational awareness skills.
- C-substitute for a lack of aviation experience.

Advanced avionics were designed to increase safety as well as the utility of the aircraft. Safety is enhanced by enabling better situational awareness. (PLT104, AA.I.A.R3) — FAA-H-8083-6

ALL

9853. When a pilot believes advanced avionics enable operations closer to personal or environmental limits,

A—greater utilization of the aircraft is achieved.

- B—risk is increased.
- C-risk is decreased.

Advanced avionics can sometimes have a negative effect on pilot risk-taking behavior, where more information results in pilots taking more risk than they might be willing to accept without the information. Advanced avionics should be used to increase safety, not risk. (PLT104, AA.I.A.R3) — FAA-H-8083-6

ALL

9853-1. In advanced avionics aircraft, proper automation management requires

- A—relying on flight management systems to navigate in order for the pilot to perform other tasks.
- B—a thorough understanding of how the autopilot interacts with other systems.
- C—the pilot to refrain from monitoring the automation after initial programming.

Advanced avionics offer multiple levels of automation, from strictly manual flight to highly automated flight. No one level of automation is appropriate for all flight situations, but in order to avoid potentially dangerous distractions when flying with advanced avionics, the pilot must know how to manage the CDI, the navigation source, and the autopilot. It is important for a pilot to know the peculiarities of the particular automated system being used. (PLT104, AA.I.F.K3) — FAA-H-8083-25

ALL

9854. Automation in aircraft has proven

A-to present new hazards in its limitations.

B—that automation is basically flawless.

C—effective in preventing accidents.

Advanced avionics were designed to increase safety as well as the utility of the aircraft. However, the systems are not infallible. While automation does help prevent many existing types of errors, it has also created new kinds of errors. (PLT104, AA.I.A.R3) — FAA-H-8083-6

9769-2 [C]

9830 [B]

9853-1 [B]

9853 [B]



Seat upgrade? Roger that.

Written by the industry experts, these books provide insights for career pilots. Rely on ASA for advice on how to get your foot in the door at the airlines, hone your interview skills, and operate effectively as a professional aviator.



asa2fly.com/Careers

AIRLINE TRANSPORT PILOT 2022 TEST PREP

STUDY & PREPARE

Pass your test and know what is essential to become a safe, competent pilot and aircraft dispatcher—from the most trusted source in aviation training

Rely on the time-proven and dependable ASA Airline Transport Pilot Test Prep to prepare for your FAA Knowledge Exam. Test material is expertly organized into chapters based on subject matter and includes introductory text and illustrations, questions, answer choices, answers, explanations (for correct and incorrect answers), and references for further study. This topical study promotes understanding and aids recall to provide an efficient study guide. When you're done studying, take practice tests with ASA's online simulated testing program at no additional cost!

The ASA Test Prep includes the Airman Knowledge Testing Supplement—with the same FAA legends, figures, and full-color charts you'll be issued at the testing center—to help you become familiar with all available information before you take your official test. You can count on ASA to provide you with the latest changes in the FAA Knowledge Exams through a free email subscription service and updates. ASA's *Airline Transport Pilot Test Prep* is the pilot's best resource for successful test-taking. Questions included for all Aircraft Dispatcher and ATP FAA Knowledge Exams: airplane and helicopter

Questions supported with explanations for correct and incorrect answers, FAA references for further study, and airman test report codes for remedial study

Includes the official FAA Airman Knowledge Testing Supplement

Organized by subject with introductory text for efficient and logical study

Airline Transport Pilot requirements

5 free online practice tests

Test-taking tips

Quick cross-references for easy question-finding

Free online updates and free subscription service to stay informed of test changes



SOFTWARE | APP | EBOOK available on demand from ASA at **asa2fly.com/testprep**

Explore more ways to study:



Aviation Supplies & Academics, Inc. 7005 132nd Place SE, Newcastle, Washington 98059 425-235-1500 | asa2fly.com

ASA-TP-ATP-22

